

Your Ultimate Source for OEM Repair Manuals

FactoryManuals.net is a great resource for anyone who wants to save money on repairs by doing their own work. The manuals provide detailed instructions and diagrams that make it easy to understand how to fix a vehicle.

1991 VOLVO 940 Estate OEM Service and Repair Workshop Manual


Go to manual page




CAUTION: The silicon surface must not be touched, any contamination of the surface will damage the sensor.




Remove the marked part.

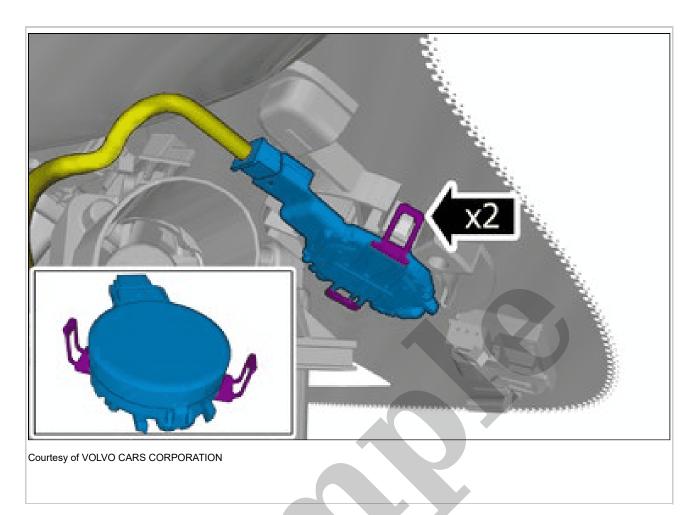

Loosen the clips.

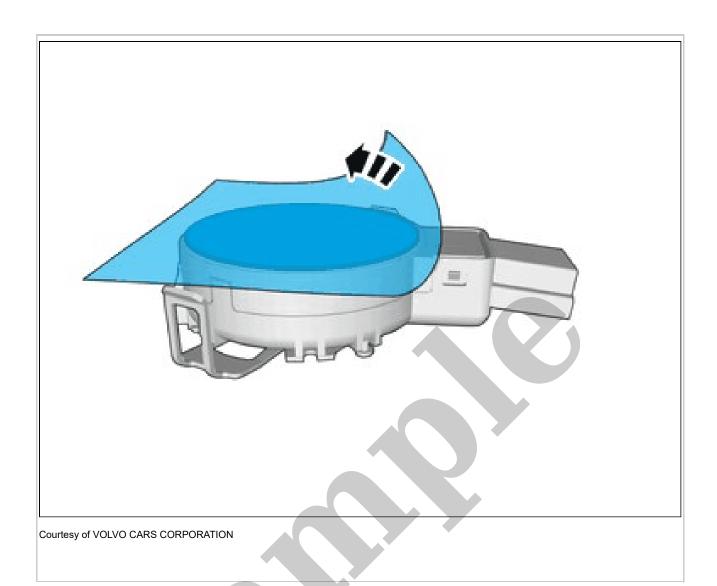


Remove the protective film.

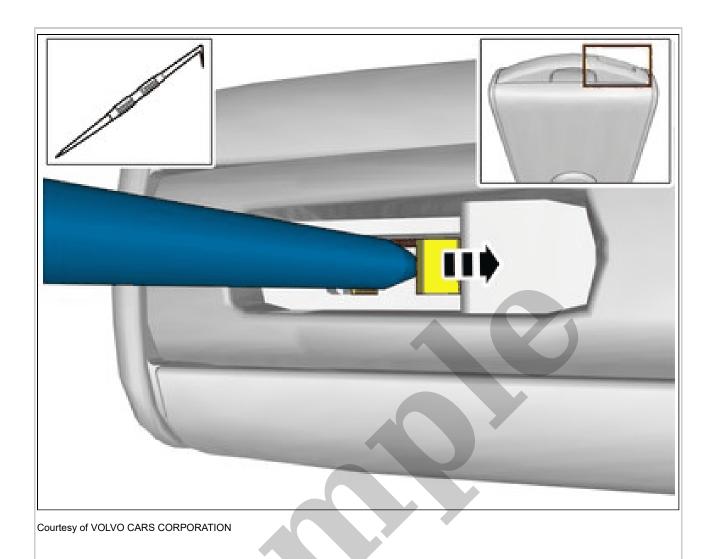


Release the lock. Hold it down.


Remove casing bumper rear. Refer to: COVER BUMPER REAR

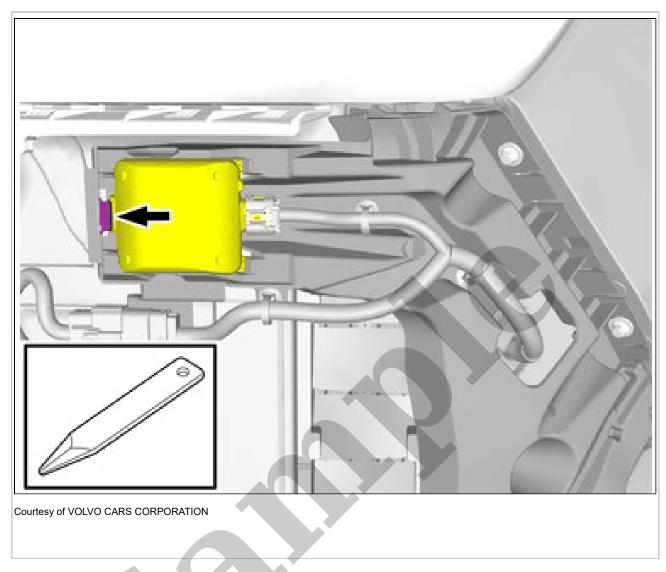

Depress the locking device. Fold marked part aside.

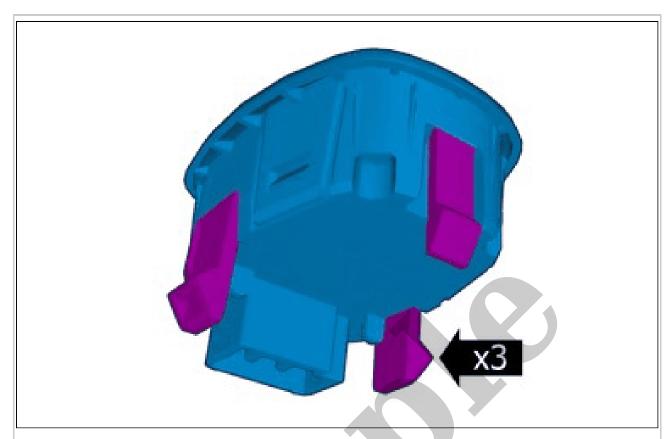

Courtesy of VOLVO CARS CORPORATION

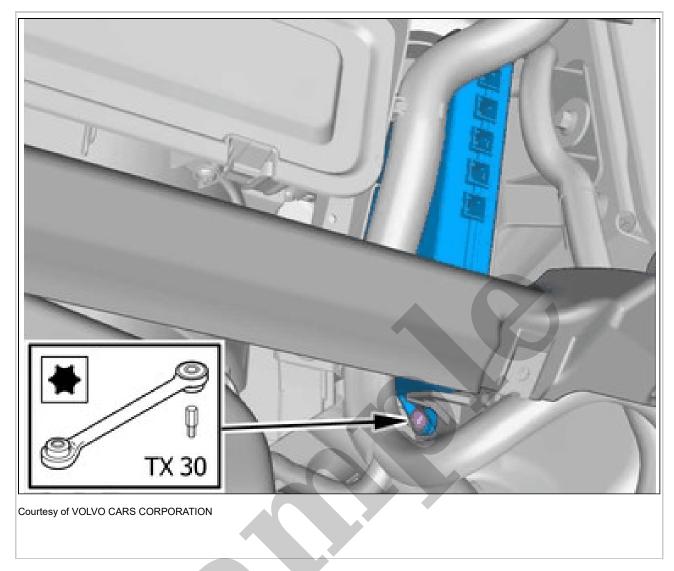

Remove the screw.
Remove the marked part.


WIDE ANGLE VISION MODULE > WIDE ANGLE VISION MODULE (WAM) [2021-2022] > INSTALLATION

To install, reverse the removal procedure.

NOTE: The following steps are only necessary when installing a new component.

Order and download the appropriate software according to: VIDA/Software/Hardware Changes Calibrate WAM according to: Diagnostics / Components / Control modules /Wide Angle Vision Module (WAM) / Diagnostic sequences / Calibrating parking assistance cameras

WIDE ANGLE VISION MODULE > WIDE ANGLE VISION MODULE (WAM) [2018-2020] > REMOVAL

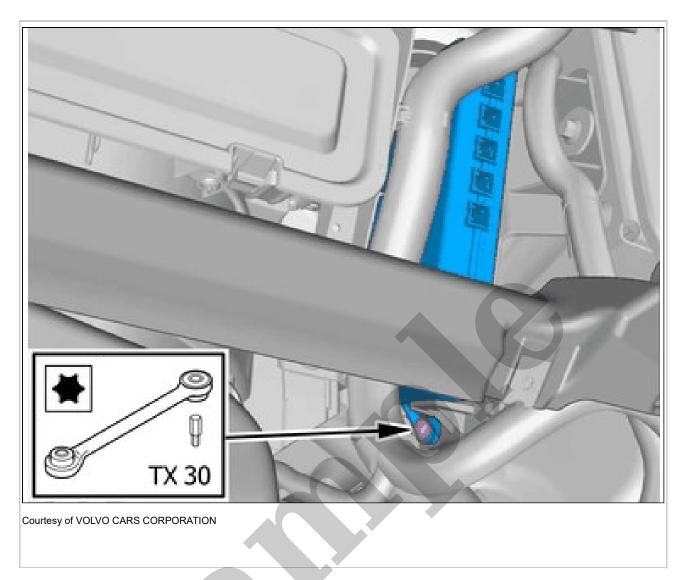

Remove the screw.
Remove the marked part.
RIGHT-HAND DRIVE VEHICLES