


Your Ultimate Source for OEM Repair Manuals


FactoryManuals.net is a great resource for anyone who wants to save money on repairs by doing their own work. The manuals provide detailed instructions and diagrams that make it easy to understand how to fix a vehicle.

1992 VOLVO 960 OEM Service and Repair Workshop Manual

Go to manual page

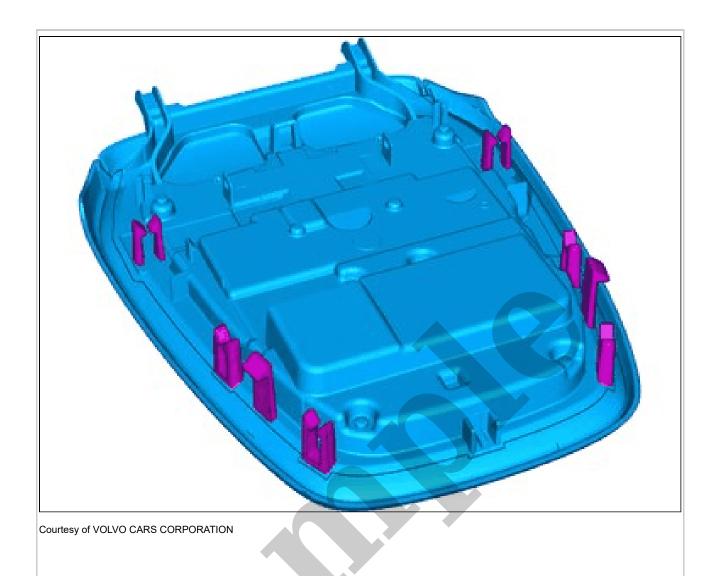


NOTE: The graphic shows the back of the component before removal.

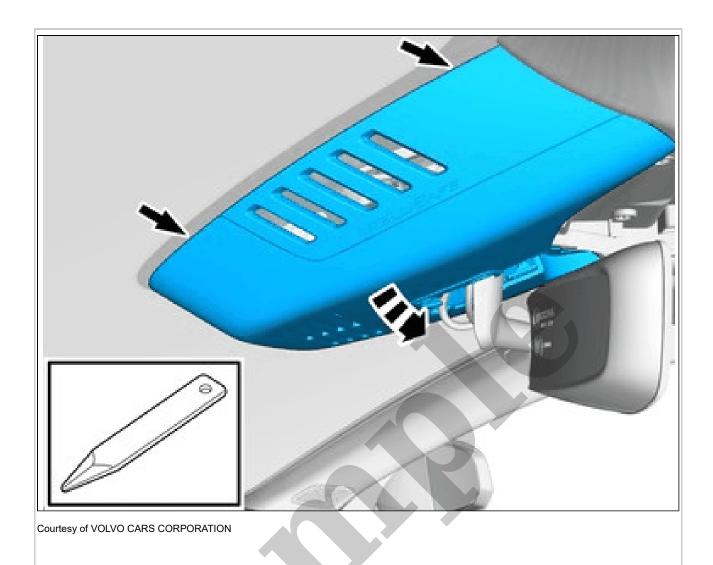


Release the catches.
Repeat on the other side.
Remove the marked part.

Use: Interior trim remover

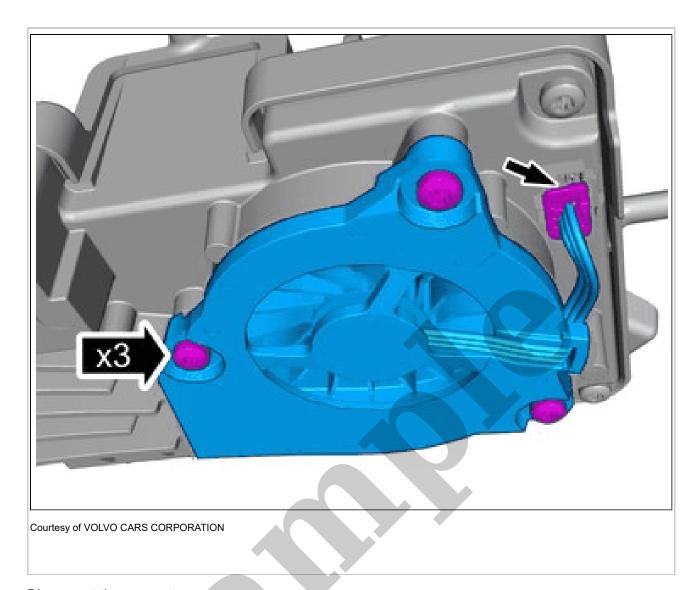


Disconnect the connector. Remove the screws. Remove the marked part.


COOLING FAN, FORWARD LOOKING CAMERA > COOLING FAN, FORWARD LOOKING CAMERA (FLC) [2022 | 2021, E400V6] > INSTALLATION

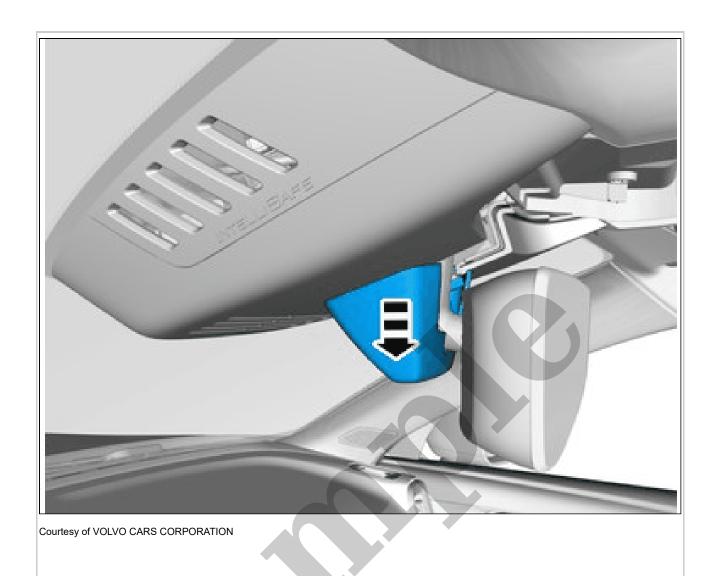

Remove the marked part.

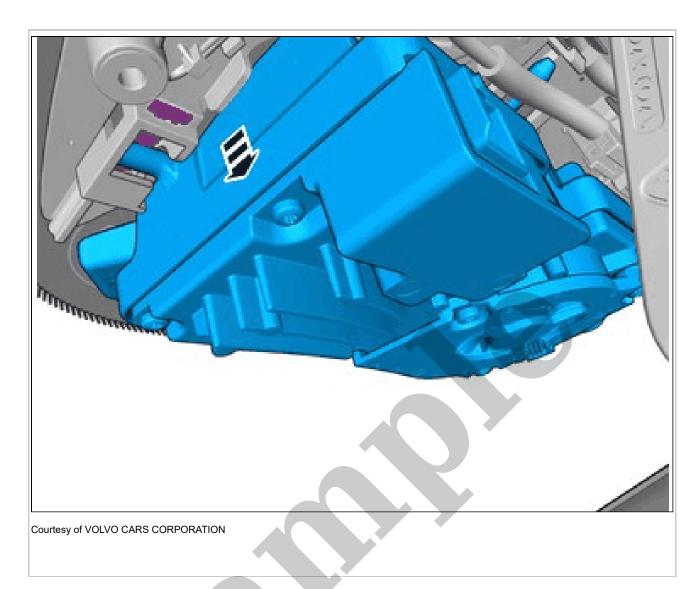


Tilt the component somewhat.

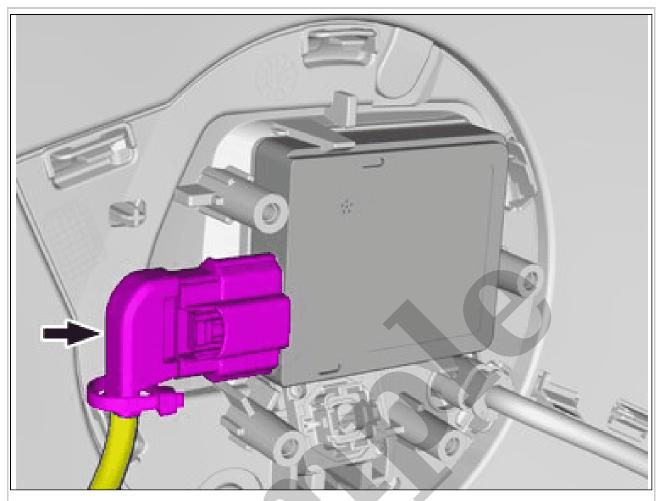


Courtesy of VOLVO CARS CORPORATION

Release the connector's catch. Disconnect the connector.

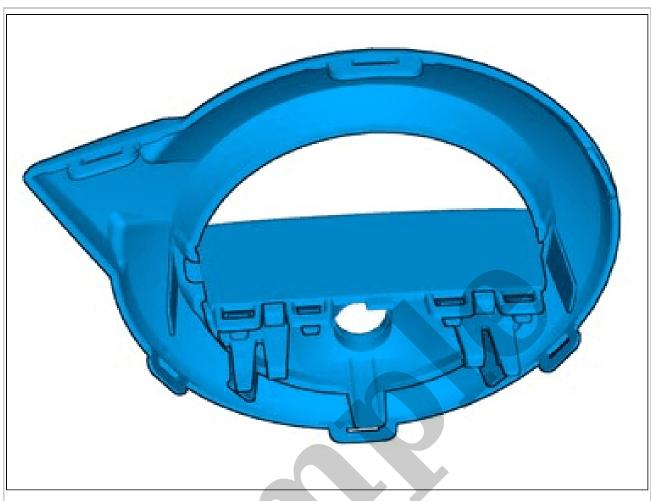

Courtesy of VOLVO CARS CORPORATION

NOTE: The graphic shows the back of the component before removal.

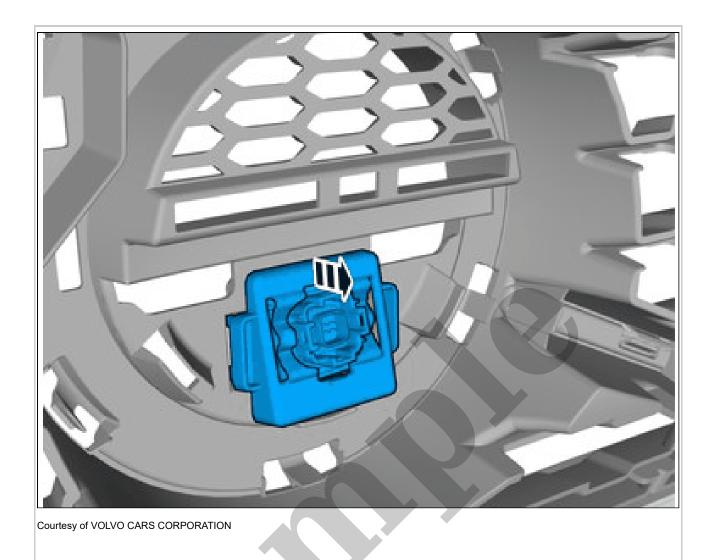

Remove the marked part.

PARKING ASSISTANCE CAMERA, FRONT > PARKING ASSISTANCE CAMERA, FRONT [2018-2020 | 2021-2022, B4204T18 | 2021-2022, B4204T47] > INSTALLATION


To install, reverse the removal procedure.

Calibrate WAM according to: Diagnostics / Components / Control modules /Wide Angle Vision Module (WAM) / Diagnostic sequences / Calibrating parking assistance cameras

PARKING ASSISTANCE CAMERA, FRONT > PARKING ASSISTANCE CAMERA, FRONT [2021-2022, E400V6] > REMOVAL

Perform battery disconnecting and connecting. Refer to: BATTERY DISCONNECTING AND CONNECTING

Remove casing bumper front. Refer to: COVER BUMPER FRONT

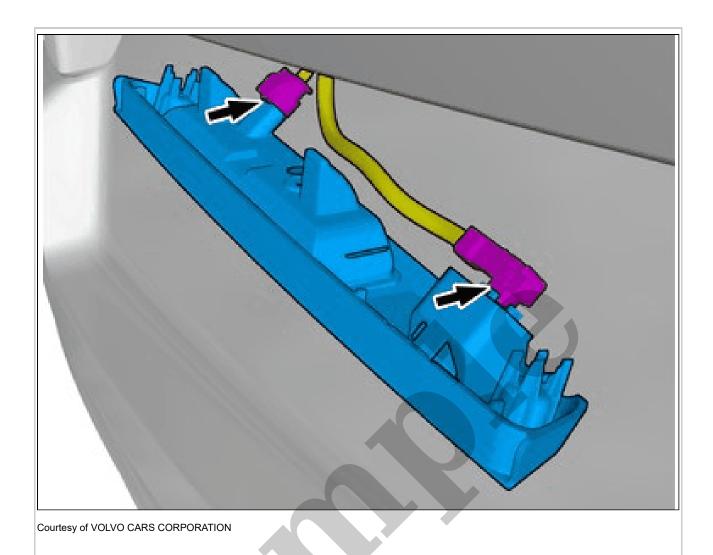

Disconnect the connectors. Remove the marked part.