

Your Ultimate Source for OEM Repair Manuals

FactoryManuals.net is a great resource for anyone who wants to save money on repairs by doing their own work. The manuals provide detailed instructions and diagrams that make it easy to understand how to fix a vehicle.

1993 CHEVROLET Tahoe 3 doors OEM Service and Repair Workshop Manual

[Go to manual page](#)

Verify the component turns On and Off when connecting and disconnecting the jumper wire:P13 Horn Assembly

◦ **If the component does not turn On and Off**

1. Ignition/Vehicle » Off & Remove » Jumper wire(s)
 2. Disconnect the electrical connector:X3X50A Fuse Block - Underhood
 3. Ignition » On / Vehicle » In Service Mode
 4. Test for less than 1 V between the test points:Control circuit terminal 19 X5@Control module harness&Ground
 - If 1 V or greater » Repair the short to voltage on the circuit.
 - If less than 1 V
 5. Ignition/Vehicle » Off
 6. Test for infinite resistance between the test points:Control circuit terminal 19 X5@Control module harness&Ground
 - If less than infinite resistance » Repair the short to ground on the circuit.
 - If infinite resistance
 7. Test for less than 2 Ω between the test points:Control circuit terminal 19 X5@Control module harness&Terminal L5 X3@Fuse/Junction Block Harness
 - If 2 Ω or greater » Repair the open/high resistance in the circuit.
 - If less than 2 Ω » Test or replace the component:X50A Fuse Block - Underhood
- **If the component turns On and Off**
5. Replace the component:K9 Body Control Module

Repair Instructions

Perform the Diagnostic Repair Verification after completing the repair: [Diagnostic Repair Verification](#)

- [Front Compartment Fuse Block Replacement](#)
- For control module replacement, programming, and setup refer to: [Control Module References](#)

CONN_X5 X5

CAV_L5 L5

CONN_X3 X3

29 Horn Control

29_BN/GY 29 BN/GY

CAV_J2 J2

CONN_X4 X4

550_BK 550 BK

3287 Horn Switch Signal

3287_GN/WH 3287 GN/WH

CAV_1 1

CONN_X1 X1

CAV_18 18

CONN_X3 X3

3287_GN/WH 3287 GN/WH

CAV_10 10

CONN_X2 X2

28_BN/WH 28 BN/WH

550 Ground

CAV_2 2

_BK BK

_BK BK

CAV_1 1

CAV_2 2

CAV_B B

3287_GN/WH 3287 GN/WH

1450 Ground

1450_BK 1450 BK

CAV_A A

KR3 KR3 Horn Relay

X85 X85 Steering Wheel Air Bag Coil

Steering Column Components

X85 Steering Wheel Air Bag Coil X1

X85 Steering Wheel Air Bag Coil X2

X85 Steering Wheel Air Bag Coil X3

X85 Steering Wheel Air Bag Coil X4

P13 P13 Horn Assembly

Left Front of Vehicle Components

P13 Horn Assembly

S33 S33 Horn Switch


S33 Horn Switch

Sample

YOUR CURRENT VEHICLE

Horn Replacement

Horn Replacement

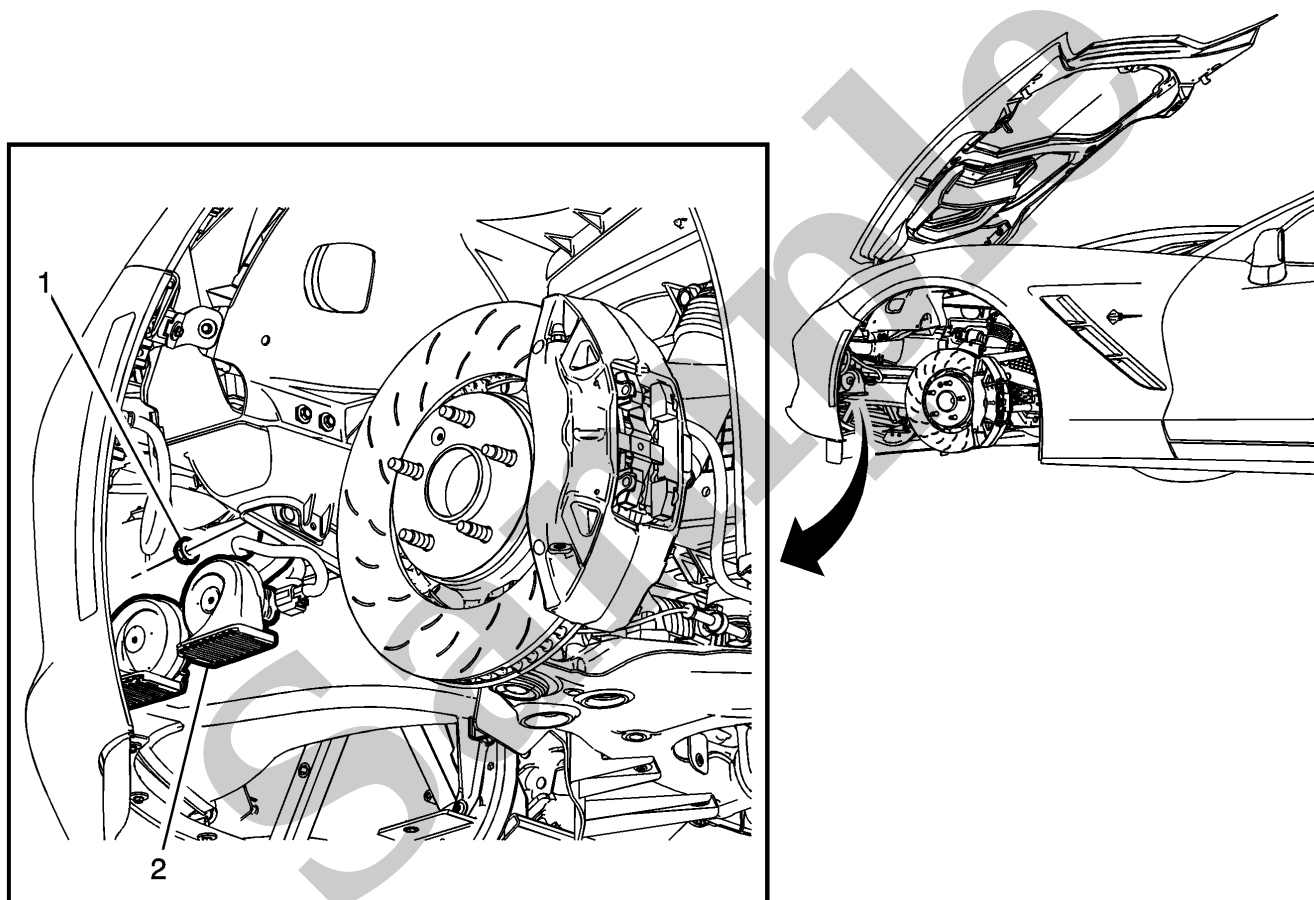

Horn Replacement

Callout	Component Name
Preliminary Procedure Remove the left front wheelhouse liner. Refer to Front Wheelhouse Liner Replacement .	
1	Horn Nut