

# Your Ultimate Source for OEM Repair Manuals

FactoryManuals.net is a great resource for anyone who wants to save money on repairs by doing their own work. The manuals provide detailed instructions and diagrams that make it easy to understand how to fix a vehicle.

2021 Jeep Gladiator Service and Repair Manual

Go to manual page



Pin	Cicuit	Cicuit Function	Color	Gauge/Size	Option
		STARTER_ GE	NERATO	R	
1	A8	FUSED B(+)	RD	35.0	

# **Steering Wheel-Heated**

#### STEERING WHEEL-HEATED


HARNESS_CONNECTOR	Option:Standard	
Connector Details	Harness Family	
Color	NA	
Part Number	HARDWIRED	Steering_Wheel
Repair Kit Part Number	Not Serviced	Steering_Wheel
Part Description		Steering_Wheel
Cavity Count	N/A	Steering_Wheel
Location View	Location View	Steering_Wheel

Pin	Cicuit	Cicuit Function	Color	Gauge/Size	Option
	Steering_Wheel				
1	C91	POWER SUPPLY	RD	0.80	
2	C986	RETURN	ВК	0.80	

Pin	Cicuit	Cicuit Function	Color	Gauge/Size	Option
2	K108	SIGNAL	VT	0.50	



#### **Connector Views**

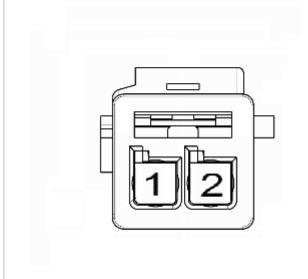

Pin	Cicuit	Cicuit Function	Color	Gauge/Size	Option
		Steering_Wh	ieel		
1	ХЗ	HORN SWITCH SENSE	DG	0.35	
2	Z92	GROUND	ВК	0.35	

## Switch/Tensioner-Seat Belt Buckle - Passenger

#### SWITCH/TENSIONER-SEAT BELT BUCKLE - PASSENGER

HARNESS_CONNECTOR	No:D2428A	Option:Standard
Connector Details		Harness Family
Color	GRAY	
Part Number	7282-6443-40	SEAT_CUSHION_PASSENGER
Repair Kit Part Number	68065022AA	SEAT_CUSHION_PASSENGER
Part Description		SEAT_CUSHION_PASSENGER
Cavity Count	2	SEAT_CUSHION_PASSENGER
Location View	Location View	SEAT_CUSHION_PASSENGER

Connector Views	
Mating Side:	

## SX154

#### SX154

HARNESS_CONNECTOR	Option:Standard	
Connector Details	Harness Family	
Color	NA	
Part Number	AGV36375	IP
Repair Kit Part Number	Not Serviced	IP
Part Description		IP
Cavity Count	N/A	IP
Location View	Location View	IP

Pin	Cicuit	Cicuit Function	Color	Gauge/Size	Option
	IP				
1	X154	SPEAKER (+)	GY	0.75	

## **SX700**

#### SX700

HARNESS_CONNECTOR	Option:Standard	
Connector Details	Harness Family	
Color	NA	
Part Number	AGV36375	FASCIA_REAR
Repair Kit Part Number	Not Serviced	FASCIA_REAR
Part Description		FASCIA_REAR
Cavity Count	N/A	FASCIA_REAR
Location View	Location View	FASCIA_REAR

Pin	Cicuit	Cicuit Function	Color	Gauge/Size	Option
	FASCIA_REAR				
1	X700	POWER SUPPLY	GY	0.50	

## **SZ31**

#### **SZ31**

HARNESS_CONNECTOR	Option:Standard	
Connector Details	Harness Family	
Color	NA	
Part Number	AGV36375	UNDERBODY
Repair Kit Part Number	Not Serviced	UNDERBODY
Part Description		UNDERBODY
Cavity Count	N/A	UNDERBODY
Location View	Location View	UNDERBODY

Pin	Cicuit	Cicuit Function	Color	Gauge/Size	Option		
UNDERBODY							
1	Z31	SHIELD	ВК	0.50			
1	Z31	SHIELD	NA	0.35			



## **SZ906**

#### SZ906

HARNESS_CONNECTOR	Option:Standard	
Connector Details	Harness Family	
Color	NA	
Part Number	AGV36375	POWERTRAIN
Repair Kit Part Number	Not Serviced	POWERTRAIN
Part Description		POWERTRAIN
Cavity Count	N/A	POWERTRAIN
Location View	Location View	POWERTRAIN

Pin	Cicuit	Cicuit Function	Color	Gauge/Size	Option			
POWERTRAIN								
1	Z906	GROUND	ВК	0.75				