


Your Ultimate Source for OEM Repair Manuals

FactoryManuals.net is a great resource for anyone who wants to save money on repairs by doing their own work. The manuals provide detailed instructions and diagrams that make it easy to understand how to fix a vehicle.

2023 Jeep Renegade Service and Repair Manual

[Go to manual page](#)

Connector Views

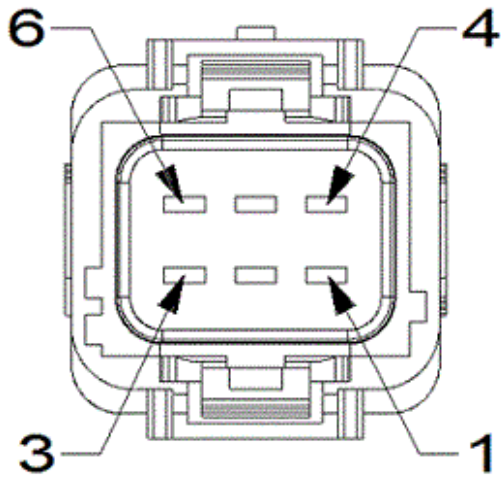


Isometric View:



Wire Insertion Side:

Connector Views

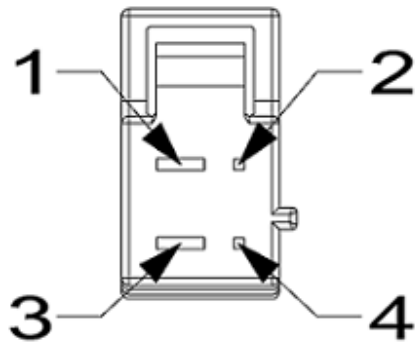


Isometric View:



Wire Insertion Side:

Connector Views

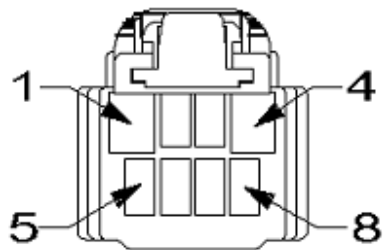

Pin	Cicuit	Cicuit Function	Color	Gauge/Size	Option
HEADLINER_SUNROOF					
1	Q556	OPEN SIGNAL	VT	2.0	
2	Q958	HALL EFFECT SIGNAL	GN	0.50	
3	Q959	SENSOR RETURN	GY	0.50	
4	Q56	CLOSE SIGNAL	BK	2.0	
5	Q957	5 VOLT SUPPLY	BU	0.50	

MOTOR-VENT-SEAT BACK-LEFT REAR

MOTOR No:D3297A		Option:EXCEPT 3RD ROW
Connector Details		Harness Family
Color	BLACK	
Part Number	6098-7923	SEAT_BACK_2ND_ROW
Repair Kit Part Number		SEAT_BACK_2ND_ROW
Part Description		SEAT_BACK_2ND_ROW
Cavity Count	4	SEAT_BACK_2ND_ROW
Location View	Location View	SEAT_BACK_2ND_ROW

Pin	Circuit	Circuit Function	Color	Gauge/Size	Option
SEAT_BACK_2ND_ROW					
1	P231	POWER SUPPLY	GN	0.35	
2	N0	NO CONNECT	NA	0	
3	P869	PWM CONTROL	GY	0.35	
4	Z922	GROUND	BK	0.35	

YOUR CURRENT VEHICLE


Motor-Vent-Seat Back-Right Rear

MOTOR-VENT-SEAT BACK-RIGHT REAR

MOTOR No:D3298A		Option:3RD ROW
Connector Details		Harness Family
Color	BLACK	
Part Number	6098-7923	SEAT_2ND_ROW_RIGHT
Repair Kit Part Number		SEAT_2ND_ROW_RIGHT
Part Description		SEAT_2ND_ROW_RIGHT
Cavity Count	4	SEAT_2ND_ROW_RIGHT
Location View	Location View	SEAT_2ND_ROW_RIGHT

Pin	Cicuit	Cicuit Function	Color	Gauge/Size	Option
SEAT_2ND_ROW_RIGHT					
1	P232	POWER SUPPLY	GN	0.35	
2	N0	NO CONNECT	NA	0	
3	P879	PWM CONTROL	GY	0.35	
4	Z922	GROUND	BK	0.50	

Connector Views

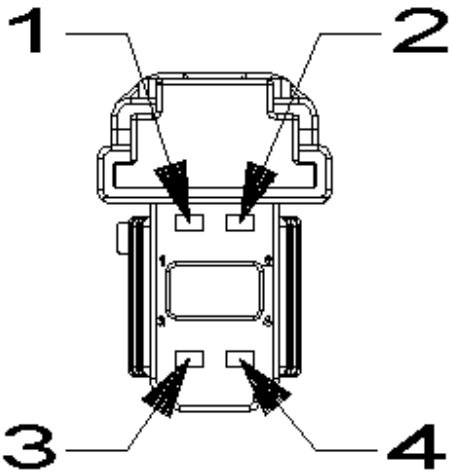

Pin	Cicuit	Cicuit Function	Color	Gauge/Size	Option
SEAT_BACK_PASSENGER					
1	P230	POWER SUPPLY	GN	0.35	
3	P859	PWM CONTROL	GY	0.35	
4	Z920	GROUND	BK	0.35	

YOUR CURRENT VEHICLE


Motor-Vent-Seat Cushion-Right Rear

MOTOR-VENT-SEAT CUSHION-RIGHT REAR

MOTOR No:D3300A		Option:3RD ROW
Connector Details		Harness Family
Color	BLACK	
Part Number	6098-7923	SEAT_2ND_ROW_RIGHT
Repair Kit Part Number		SEAT_2ND_ROW_RIGHT
Part Description		SEAT_2ND_ROW_RIGHT
Cavity Count	4	SEAT_2ND_ROW_RIGHT
Location View	Location View	SEAT_2ND_ROW_RIGHT

Pin	Cicuit	Cicuit Function	Color	Gauge/Size	Option
SEAT_2ND_ROW_RIGHT					
1	P232	POWER SUPPLY	GN	0.35	
2	N0	NO CONNECT	NA	0	
3	P878	PWM CONTROL	BN	0.35	
4	Z922	GROUND	BK	0.50	

Connector Views

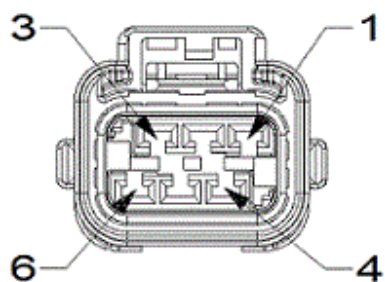


Isometric View:



Wire Insertion Side:

Connector Views

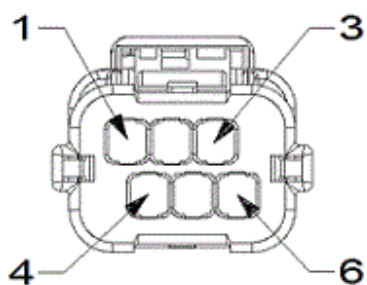

Pin	Circuit	Circuit Function	Color	Gauge/Size	Option
DOOR_PASSENGER					
1	Q12	MOTOR (UP)	OG	2.0	RHD
1	Q22	MOTOR (DOWN)	OG	2.0	LHD
2	N0	NO CONNECT	NA	0	
3	Q12	MOTOR (UP)	OG	2.0	LHD
3	Q22	MOTOR (DOWN)	OG	2.0	RHD
4	Q990	SENSOR RETURN	BK	0.50	
5	Q306	POWER SUPPLY	OG	0.50	
6	Q302	HALL EFFECT SIGNAL	OG	0.50	